

Date: Tuesday, 27/05/2008 9:29:09 AM
User: Linda Lacelle

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: MAINTENANCE STEP, LH
Job Number	: 39506		
Estimate Number	: 11283		
P.O. Number	:	Part Number	: D3436043
This Issue	: 27/05/2008 S.O. No. :	Drawing Number	: D3436 REV A
Prsht Rev.	: NC	Project Number	: N/A
First Issue	: / / Type : LARGE FAB ASSY	Drawing Revision	: A
Previous Run	: 38180	Material	:
Written By	:	Due Date	: 30/05/2008 Qty: 3 Um: Each
Checked & Approved By	:		
Comment	: Est .A 05.05.11 New Issue KJ/JLM		

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 D34361 Clamp



Comment: Qty.: 1.0000 Each(s)/Unit Total: 3.0000 Each(s)

Clamp

Pick:

Qty Part Number Description Batch

1 D3436-1 Clamp m17679

08.05.29 3

2.0 D34363 Left Step



Comment: Qty.: 1.0000 Each(s)/Unit Total: 3.0000 Each(s)

LH Step

Pick:

Qty Part Number Description Batch

1 D3436-3 LH Step B 23354

08.05.29 3

3.0 D34365 Bushing



Comment: Qty.: 4.0000 Each(s)/Unit Total: 12.0000 Each(s)

Bushing

Pick:

Qty Part Number Description Batch

4 D3436-5 Bushing B 23351

08.05.29 3

4.0 D34367 Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 3.0000 Each(s)

Cap

Pick:

Qty Part Number Description Batch

1 D3436-7 Cap B 38196

08.05.29 3

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 27/05/2008 9:29:09 AM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: MAINTENANCE STEP, LH

Job Number: 39506

Part Number: D3436043

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

Weld bushings D3436-5 and clamp D3436-1 using welding Jig DT8772 and Dwg D3436 Dwg Rev: A

Qty	Part Number	Description	Batch
A/R/N/A	4130 Welding Rod	M100075	

Weld left step D3436-7 using welding Jig DT8773 and Dwg D3436 Dwg Rev: A

Qty	Part Number	Description	Batch
A/R/N/A	4130 Welding Rod	M100075	

Weld cap D3436-7 as per Dwg D3436 Dwg Rev: A

Qty	Part Number	Description	Batch
A/R/N/A	4130 Welding Rod	M100075	

[Handwritten signature] 08.05.29 3

6.0

BAND SAW

BAND SAW



Comment: BAND SAW

Slit part D3436-041 on bandsaw as per Dwg D3436

[Handwritten signature] 08.05.29 3

7.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

[Handwritten signature] 08.05.30 (3)

8.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

[Handwritten signature] 08.05.30 (3) LH

9.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

Deburr

[Handwritten signature] 08.05.30 3

10.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.2) as per QSI 005 4.3

Apply black anti-skid paint as per Dwg D3436 and QSI 005 4.4

START TIME:

OVEN TEMPERATURE:

9:30
400°

M107897 AD 08.05.30 XS
[Handwritten signature] 08.05.30 (2)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: P Date: 20/05/30
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 27/05/2008 9:29:09 AM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: MAINTENANCE STEP, LH

Job Number: 39506

Part Number: D3436043

Job Number:



Seq. #:

Machine Or Operation:

Description :

FINISH TIME:

10:30

11.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

08/05/30 (3)

12.0

D34369

Pad



Comment: Qty.: 2.0000 Each(s)/Unit Total : 6.0000 Each(s)

Pad

Install pad using contact cement as per manufacturer's instructions and Dwg D3436

Dwg Rev: A

Pick:

Qty Part Number Description

Batch

2 D3436-9 Pad

A/R N/A Contact Cement

B35490 (2X) B39520 (4X)
M107860

08/05/30 (3)

13.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08/05/30 (3) (3 LH)

14.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: PEP-39 502

08/05/30 (3)

15.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

08/05/30 (3)

Job Completion



08/05/30

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN MB	DRAWN BY MB	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D3436	REV. A SHEET 1 OF 4
DATE 05.04.28	TITLE MAINTENANCE STEP		SCALE 1:4
A	05.04.28	NEW ISSUE	

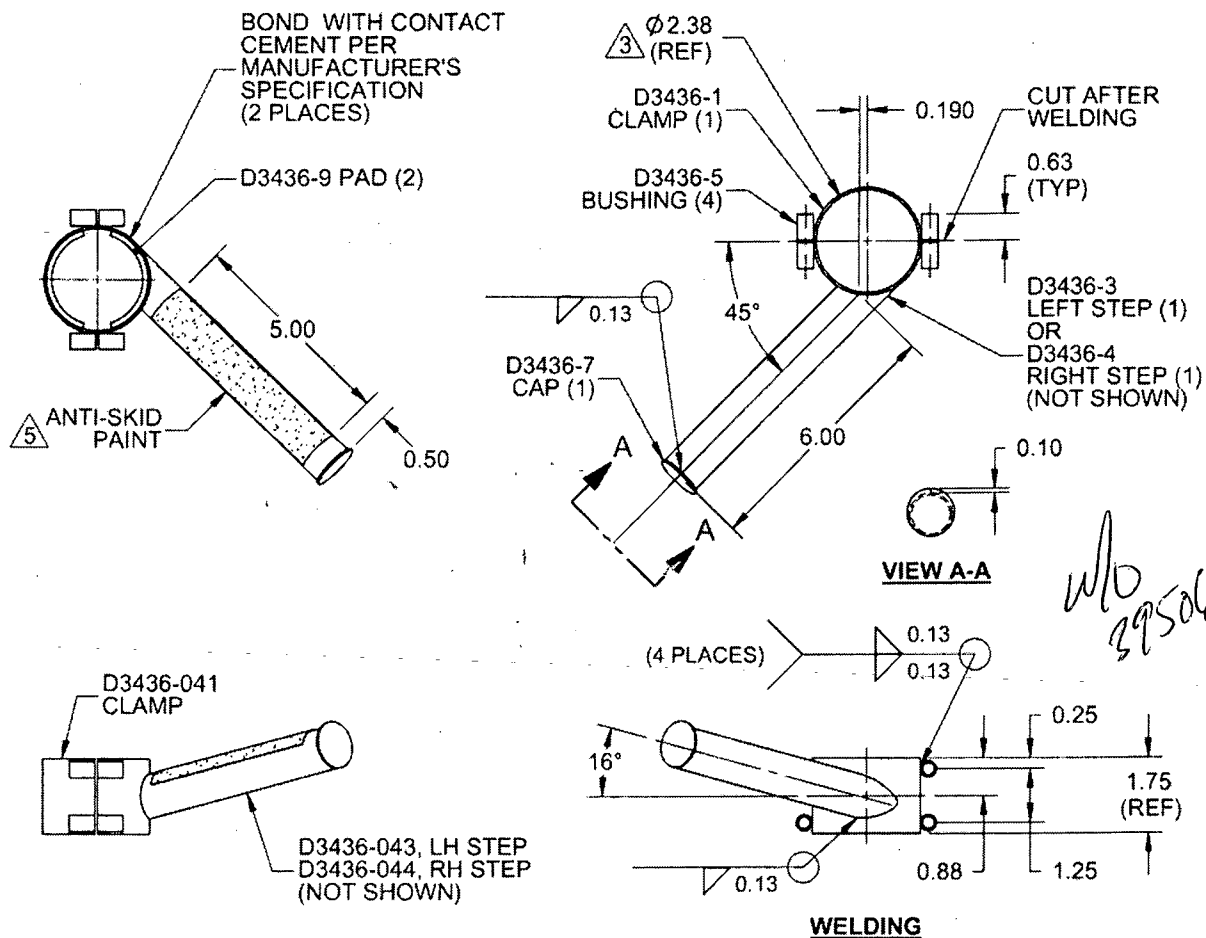

NOTES:

- 1) POSITION PARTS AS PER JIGS DT8772 AND DT8773
- 2) WELD PER DART QSI 004
- 3) FILLET BOTH TOP AND BOTTOM EDGES OF CLAMP ALONG 2.38 I.D. SECTION TO 0.03 RADIUS TO PREVENT SCORING AND SCRATCHING OF SKID CROSS TUBE
- 4) FINISH: POWDER COAT WHITE GLOSS (4.3.5.2) PER DART QSI 005 4.3
- 5) APPLY BLACK ANTI-SKID PAINT AS SHOWN PER DART QSI 005 4.4
- 6) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 7) ALL DIMENSIONS ARE IN INCHES

RELEASED



05.05.27 *[Signature]*

COPYRIGHT © 2005 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.





DESIGN MB	DRAWN BY MB	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D3436	REV. A SHEET 2 OF 4
DATE 05.04.28	TITLE MAINTENANCE STEP		SCALE 1:2

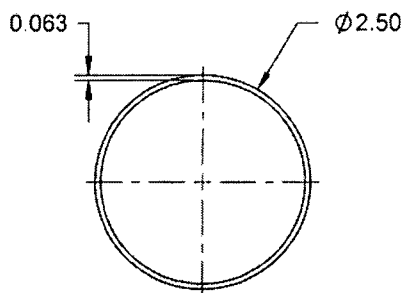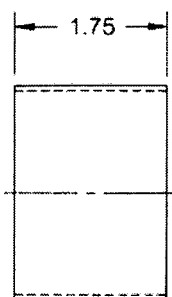

D3436-1 CLAMP

- 1) MATERIAL: AISI 4130N STEEL TUBING PER MIL-T-6736, AMS 6371, 6360, 6361, 6362, 6373 OR 6374 (REF. DART SPEC. M4130N-T2500W063)

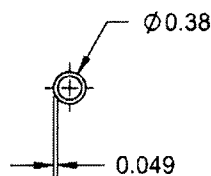

D3436-5 BUSHING

- 2) MATERIAL: AISI 4130N STEEL TUBING PER MIL-T-6736, AMS 6371, 6360, 6361, 6362, 6373 OR 6374 (REF. DART SPEC. M4130N-T0375W049)

RELEASED
05-05-27 *[Signature]*

D3436-1/-5, GENERAL NOTES:



- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
4) ALL DIMENSIONS ARE IN INCHES
5) BREAK ALL SHARP EDGES 0.005 TO 0.010

COPYRIGHT © 2005 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.





DESIGN MB	DRAWN BY MB	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED H	APPROVED H	DRAWING NO. D3436	REV. A SHEET 3 OF 4
DATE 05.04.28		TITLE MAINTENANCE STEP	SCALE 1:2

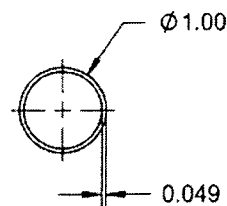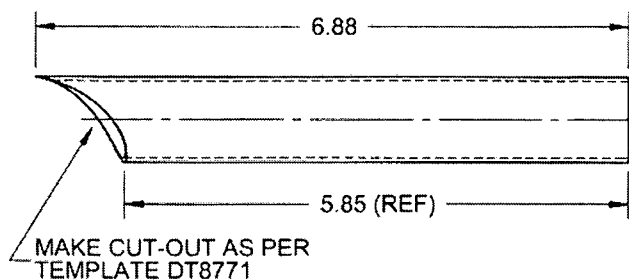

D3436-3 LEFT STEP

(D3436-4 RIGHT STEP - OPPOSITE, NOT SHOWN)

- 1) MATERIAL: AISI 4130N STEEL TUBING PER MIL-T-6736, AMS 6371, 6360, 6361, 6362, 6373 OR 6374 (REF. DART SPEC. M4130N-T1000W049)

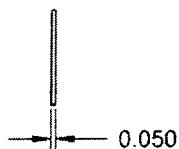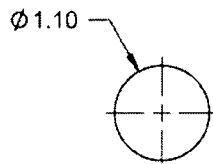

D3436-7 CAP

- 2) MATERIAL: AISI 4130N STEEL SHEET PER MIL-S-18729, AMS6350 OR AMS 6351 (REF. DART SPEC. M4130N-S050)

RELEASED

05-05-27 H

D3436-3/-7, GENERAL NOTES:



- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
4) ALL DIMENSIONS ARE IN INCHES
5) BREAK ALL SHARP EDGES 0.005 TO 0.010

COPYRIGHT © 2005 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.



DESIGN MB	DRAWN BY MB	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D3436	REV. A SHEET 4 OF 4
DATE 05.04.28		TITLE MAINTENANCE STEP	SCALE 1:1

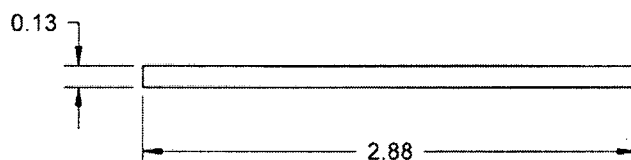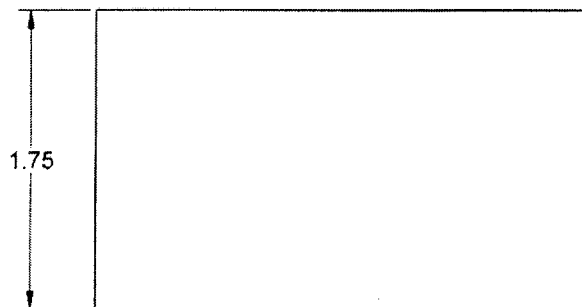

RELEASED
05-05-27 *[Signature]*

D3436-9 PAD

NOTES:

- 1) MATERIAL: 60 DUROMETER NEOPRENE SHEET, 1/8" THICK
(REF. DART SPEC. M-NEO60-S.125)
- 2) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 3) ALL DIMENSIONS ARE IN INCHES

COPYRIGHT © 2005 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.